

Figure 1

1. INTRODUCTION

SMA Hermetically-Sealed Panel Feedthrough Jack Receptacles 1053159-1, 1053181-1, 1053182-1, 1053226-1, 1053227-1, 1053254-1, 1061372-1, and 1089139-1 are designed to be mounted onto a panel using the following tools:

TOOL DESCRIPTION	PART NUMBER CROSS-REFERENCE	
	TE CONNECTIVITY	M/A-COM
Step Reamer	1055284-1	2098-0442-54
.250-36, UNS-2B Bottoming Tap [†]	--	2098-5618-54
Torque Tool	1055251-1	2098-0248-54
3/8-in. Open Wrench [†]	--	--

[†] Commercially available



Unless otherwise specified, dimensions in this instruction sheet are in metric units [with U.S. customary units in brackets].

Reasons for reissue of this instruction sheet are provided in Section 5, REVISION SUMMARY.

2. DESCRIPTION

The jack receptacle consists of a jack and metal gasket. See Figure 1.

3. ASSEMBLY PROCEDURE



Follow safety precautions included with the tools used for assembly.

STOP

4. Thread the jack into the connector housing by turning the handle of the torque tool clockwise until the handle releases. See Figure 5, Detail A.
5. While holding the collet of the torque tool with the open wrench, turn the handle counter-clockwise, and remove the jack assembly from the torque tool. See Figure 5, Detail B.
6. Install the jack assembly onto the panel.

4. REPLACEMENT AND REPAIR

Discard and replace any defective or damaged jack receptacles or metal gaskets.

5. REVISION SUMMARY

Since the previous version of this document, the following changes were made:

- Updated document to corporate requirements.

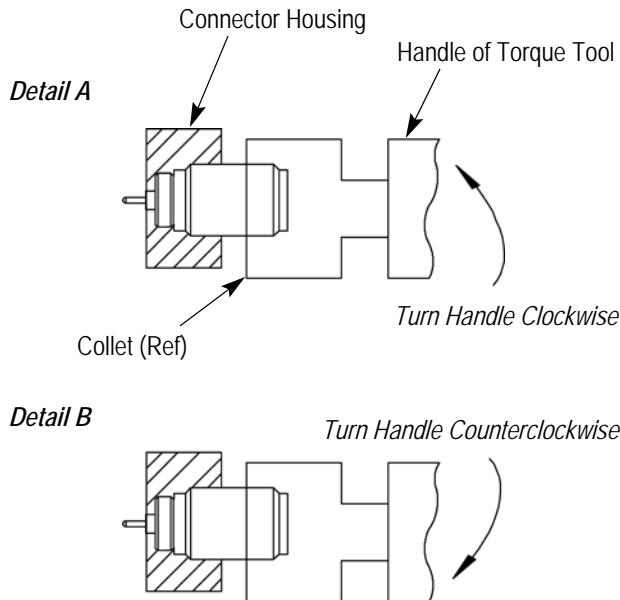


Figure 5