## Certified low-power, low-voltage accelerometer

### LPA100T-D2



Sensitivity, ±5%, 25°C	50 mV/g
Acceleration range	25 g peak
Amplitude nonlinearity	1%
Frequency response: ±5%	3 - 5,000 Hz
±10%	1 - 9,000 Hz
±3 dB	0.3 - 15,000 Hz
Resonance frequency	30 kHz
Transverse sensitivity, max	5% of axial
Sensitivity variation with temp: -25°C	-10%
+120°C	+10%
Temperature sensor:	1000 1 10000
Temperature range	-40°C to +120°C
Voltage range Temperature signal sensitivity	+2.52 to +0.77 V -10.9 mV/°C
Voltage at 0°C	+2.1 V
Power requirement: Voltage source	3.0 - 5.5 VDC
Current (no cable)	100 μA, max
Electrical noise, equiv. g:	
Broadband 2.5 Hz to 25 kHz	660 µg
Spectral 10 Hz	60 μg/√Hz
100 Hz	16 μg/√Hz
1,000 Hz	5 μg/√Hz
Output impedance, max	1,000 Ω
Bias output voltage, settling time, 25°C	<10 ms
Including temp effects	1.5 VDC ±5%
Grounding	case isolated, internally shielded
Vibration limit	500 g peak
Shock limit	5,000 g peak
Electromagnetic sensitivity, equiv. g, max	150 μg/gauss
Sealing	hermetic
Base strain sensitivity, max	0.0002 g/µstrain
Sensing element design	PZT, shear
Weight	90 grams
Case material	316L stainless steel
Mounting	1/4-28 UNF tapped hole
Mating connector	M12 style, socket
Recommended cabling	J99

Accessories supplied: SF6 mounting stud; calibration data (level 2)

#### Certifications

NOTE: See reverse for installation requirements.



Class I, Div 2 Groups A, B, C, D Class II, Div 2 Groups E, F, G Class III; T5 Ex nL IIC T



II 3 G Ex nA nC IIC T5 Gc Ex ic IIC T5 Gc Ta = -50°C to +85°C









### **Key features**

- 300 µW power consumption
- BOV settling time of <10 ms
- Certified for use in hazardous areas
- Internal temperature sensor
- · Manufactured in ISO 9001 facility

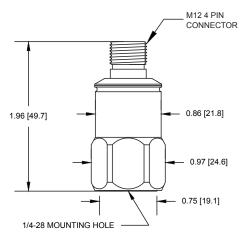



Connections	
Function	Connector pin
power	1
common	2
accel signal	3
temp signal	4
shield*	shell

\*For installations requiring CE conformance, cable shield must be tied to sensor case.

Note: Due to continuous process improvement, specifications are subject to change without notice. This document is cleared for public release.

# Certified low-power, low-voltage accelerometer



LPA100T-D2

#### Hazardous area installation requirements

The mating connection shall be made using an M12 connector in compliance with IEC 61076-2-101. This standard requires that the connectors be kept from separating using a lock nut or threaded sleeve on the mating connection. The M12 connector must have a minimum creepage distance of 1.0 mm between adjacent contacts and a minimum distance of 0.2 mm through the solid insulation between adjacent contacts. The M12 connector must use a socket designed to maintain positive compressive force on the connector pin with a minimum diameter of 0.889 mm and maintain a degree of ingress protection of at least IP54 when mated with the integral plug arrangement provided for the Accelerometer.

The equipment does not incorporate an earth bonding facility. It is the responsibility of the user to ensure that earth continuity is maintained, for example, by means of the mounting arrangement.

To limit the supply current to a maximum of  $100 \mu A$ , both the acceleration output and the temperature output must be connected to input circuits with a minimum impedance of 150,000 ohms.

The 5.5 Vdc rated supply shall be protected such that transients are limited to a maximum of 90 Vdc.

A degree of ingress protection of at least IP54 shall be maintained even when the cable connector is removed, for example by means of the fitting of a suitable cap.

#### Conditions for type protection Ex ic IIC T5 Gc installations:

The monitoring equipment must have an input impedance of at least 150,000 ohms for both the accelerometer and the temperature signals.

The cable installed must be suitable for the installation temperature and the voltage of any intermingled circuits.

Where the installation requires that the Accelerometer enclosure be grounded, this is to be done using a metal mounting stud as described in document 78013.

Note: Due to continuous process improvement, specifications are subject to change without notice. This document is cleared for public release.

Tel: +1 (301) 330-8811 Fax: +1 (301) 330-8873 info@wilcoxon.com