




SYMBOL DEFINITION					MISSING SYMBOLS					DWG STATUS				ZONE				REVISION HISTORY				AUTH	DR	CK	APV
A DIMENSION WITHOUT AN INSPECTION REPORT SYMBOL  DOES NOT REQUIRE INSPECTION. IT MAY BE CONTROLLED ON THE INDIVIDUAL COMPONENT DRAWING.					TOTAL NO OF INSPECTIONS REQUIRED	30	NO MISSING SYMBOL NUMBER					DATE	STG	REV	CHG	N/P	ALL ACTIVE PARTS - REDRAWN TO PD				207950	JGR	EDV	RC	
					LAST NO. USED	30						09AP01	R	001	-	-									

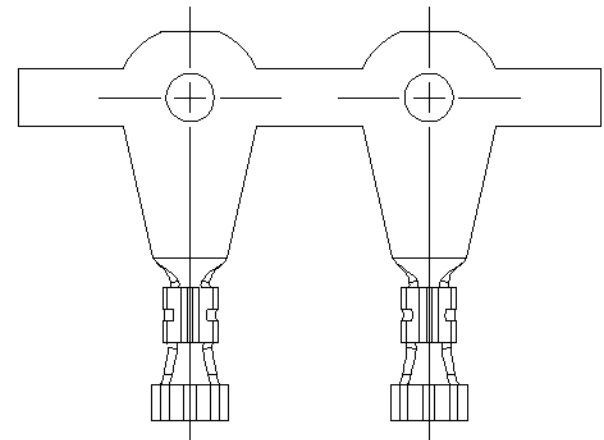


CARRIER STRIP VIEW
TYPE 101

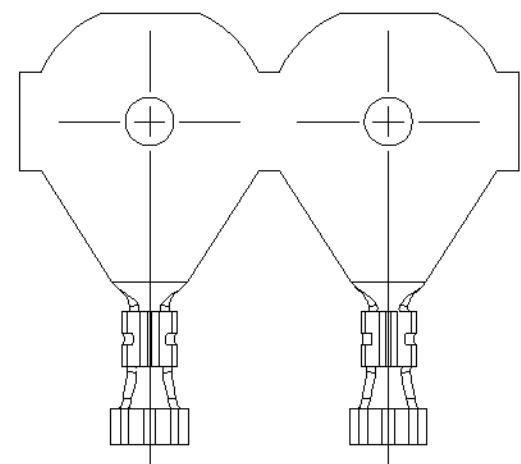


CARRIER STRIP VIEW
TYPE 102

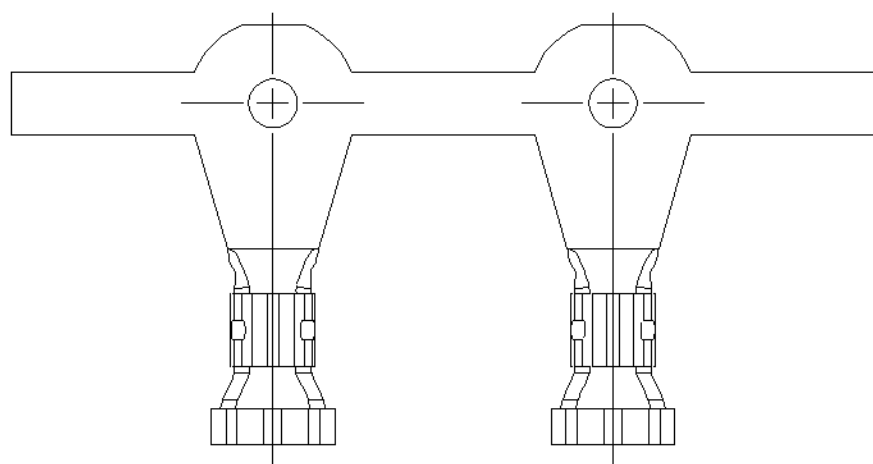


CARRIER STRIP VIEW
TYPE 103

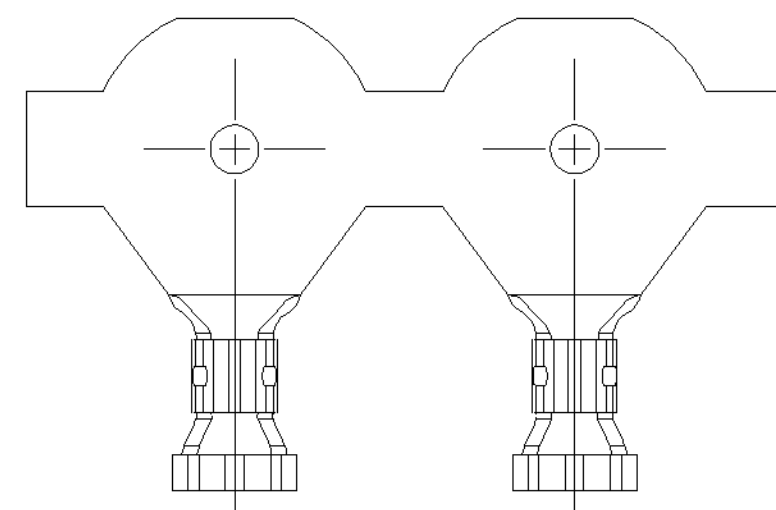


CARRIER STRIP VIEW
TYPE 104

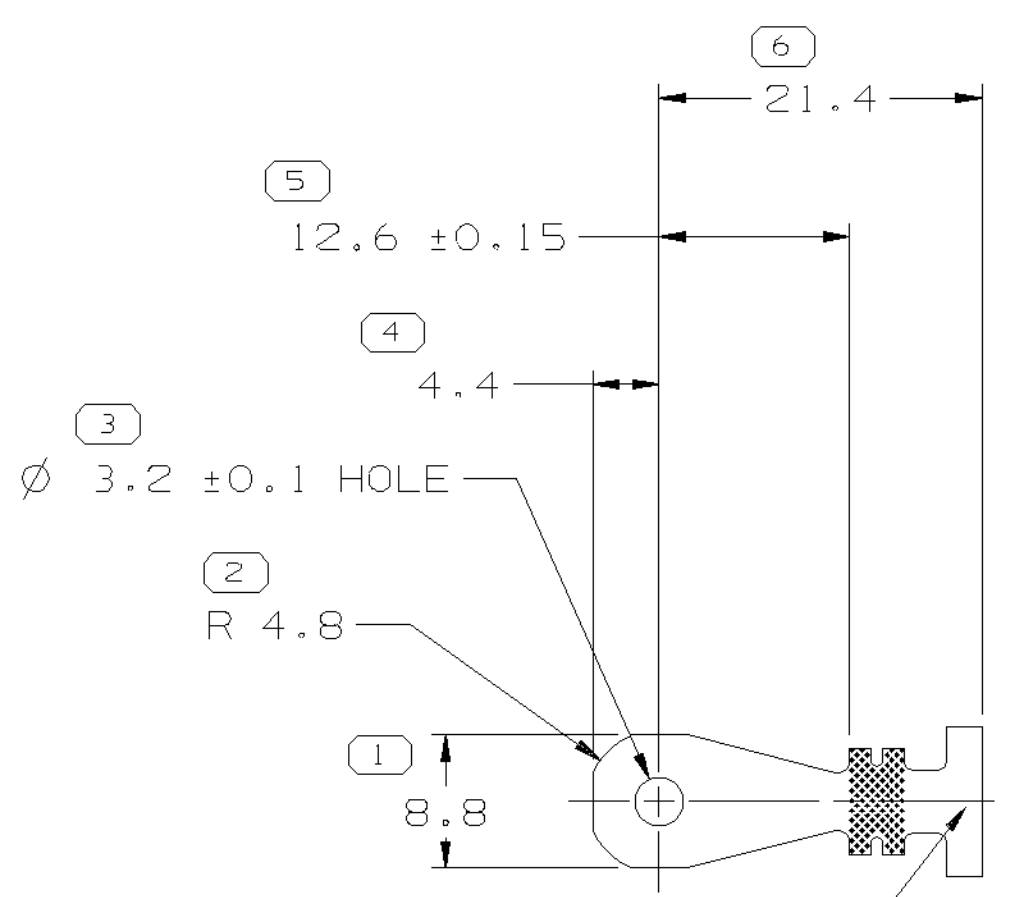


TYPE 101

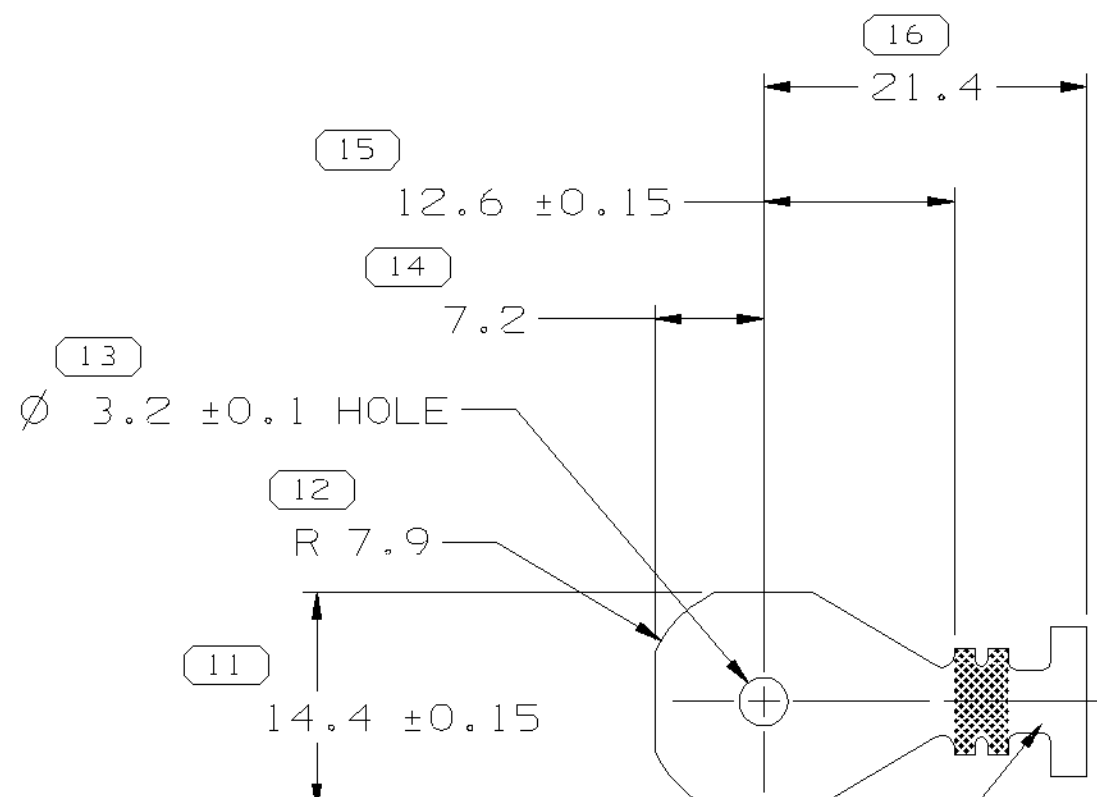




TYPE 102

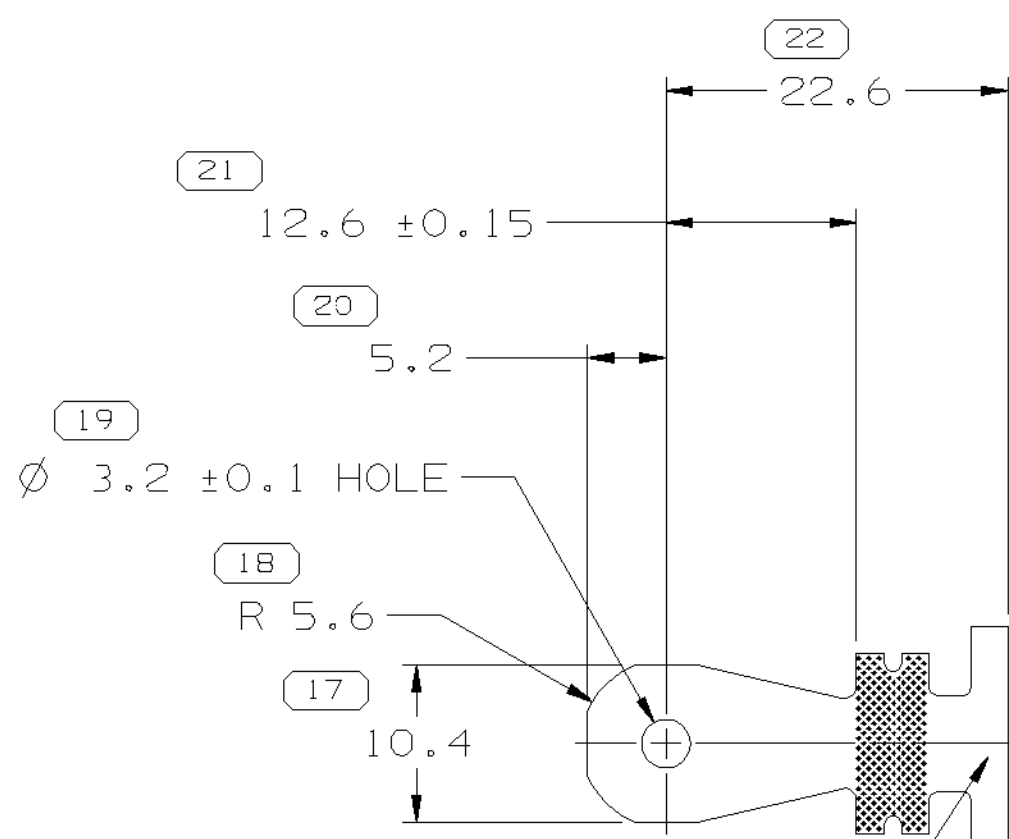

TYPE 103

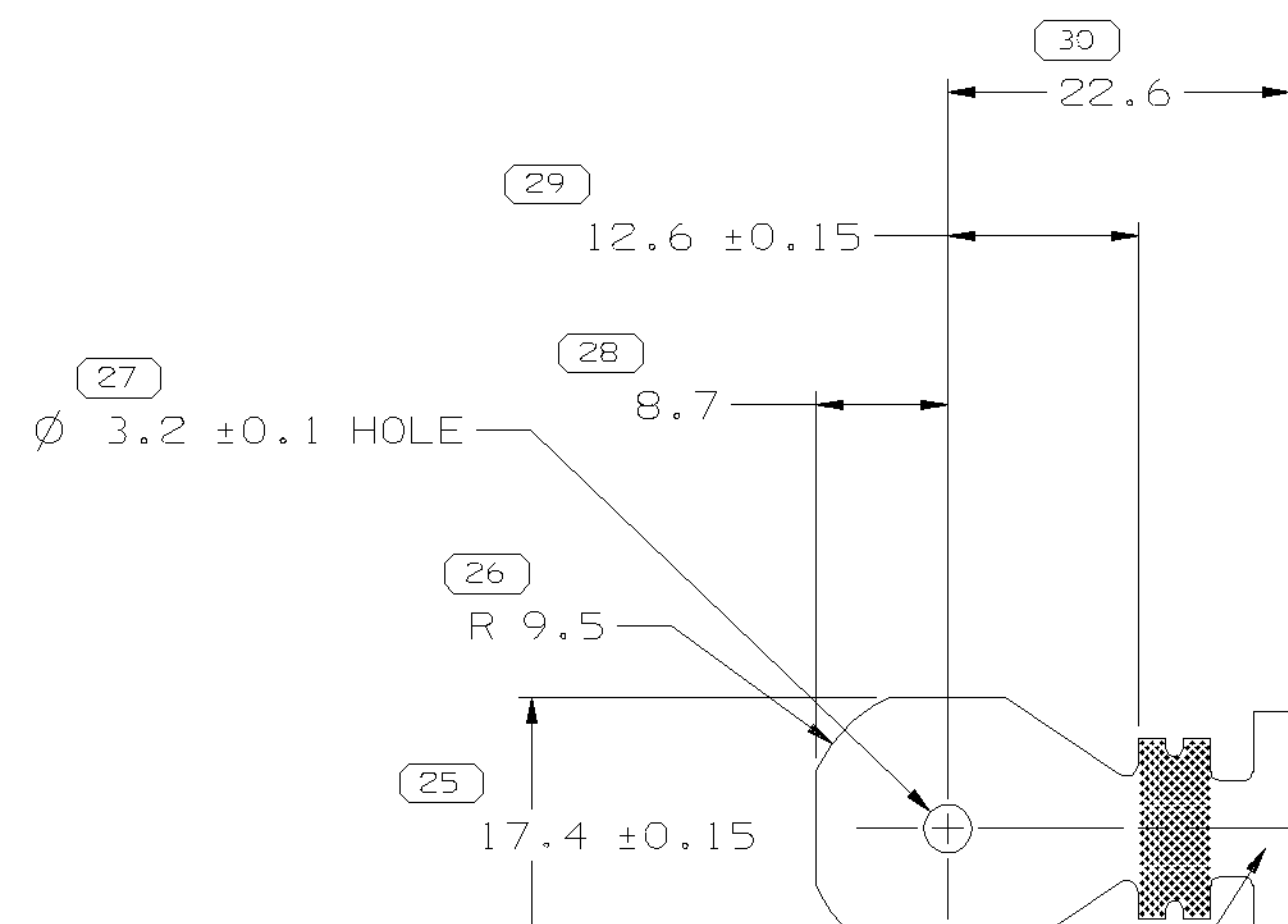


TYPE 104

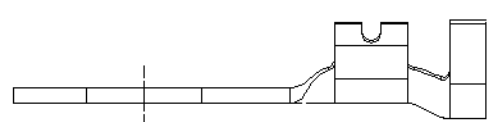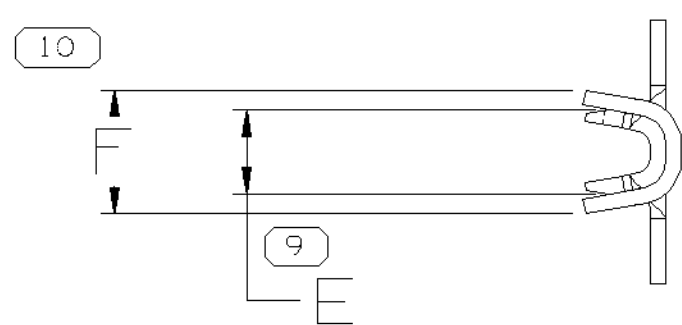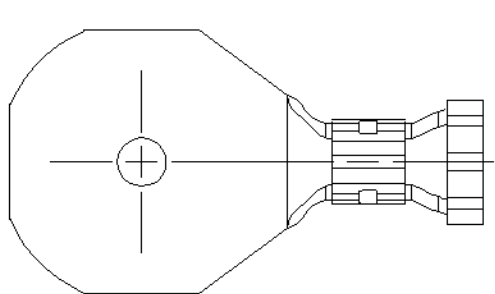

NOTES

- UNLESS OTHERWISE SPECIFIED AND/OR INDICATED:
DIMENSIONS ARE TO FACE OF VIEW SHOWN AND
AUTOMATICALLY ROUNDED BY COMPUTER FOR INSPECTION
(SEE MATH MODEL FOR PRECISE DIMENSIONS). FOR ALL
OTHER DIMENSIONS NOT SHOWN BUT REQUIRED FOR TOOL
BUILD, SEE MATH MODEL FOR PRECISE TOOL PATH DATA.
- VISIBLE CRACKS ARE NOT PERMISSIBLE.

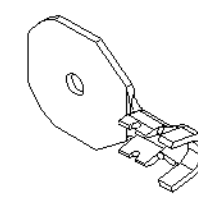

12004431	R	CI	-	-	1.024 X 31.34	M1546284	12004439	R	CI	-	-	P1546284	104	8 - 5	6.46	9	6.7	10.2
12004430	R	C	-	OBS	1.024 X 27.29	M1546283	12004438	R	CI	-	-	P1546283	103	8 - 5	6.46	9	6.7	10.2
12004429	R	D1	-	-	1.024 X 31.34	S3614284	12004437	R	D1	-	-	P3614284	104	3	4.67	12	5.6	8.2
12004428	R	D	-	OBS	1.024 X 27.79	S3614283	12004436	R	D1	-	-	P3614283	103	3	4.67	12	5.6	8.2
12004427	R	E	-	OBS	0.724 X 28.58	M3614381	12004435	R	E1	-	-	P3614381	102	2 - 1	3.97	15	4.2	6
12004426	R	E	-	OBS	0.724 X 25.81	M3614380	12004434	R	E1	-	-	P3614380	101	2 - 1	3.97	15	4.2	6
12004425	R	E1	-	-	0.645 X 28.58	M3614379	12004433	R	E1	-	-	P3614379	102	0.8 - 0.5	3.13	19	3.6	5.1
12004424	R	E	-	OBS	0.645 X 25.81	M3614378	12004432	R	E1	-	-	P3614378	101	0.8 - 0.5	3.13	19	3.6	5.1
PART NO	STG	REV	N/P	STATUS	MAT'L SIZE	SPEC	PART NO	STG	REV	N/P	STATUS	SPEC	TYPE	SIZE (MM²)	MAX DIA	I.D.	E	F
				UNPLATED							TIN PLATED						±0.4	±0.4

6		PROCESS SENSITIVE DIMENSION	
DIMENSIONS ENCLOSED IN () INDICATE REFERENCE DIMENSIONS AND NO TOLERANCE LIMITS ARE ESTABLISHED			
DIMENSIONAL RANGE (MM)		CHART G	
FROM	0	> 12	
TO	12		
TOLERANCE UNLESS OTHERWISE SPECIFIED			
	+0.15	±0.3	
ANGULAR TOLERANCE : 2°			