DATA SHEET



Zirconia O₂ Sensors

Probe Series—Screw Fit Housing



- Zirconium dioxide (ZrO₂) sensing elements
- Long life, non-depleting technology
- Integral heating element
- High accuracy
- Requires an external interface board to operate¹



Response Time




Heater Voltage



Gas Temp



Termination

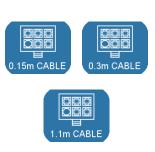



- No reference gas required
- No need for temperature stabilisation
- Variety of probe mounting positions available; 28mm, 45mm & 55mm
- M18x1.5 screw mounting

OUTPUT VALUES

technical@sstsensing.com

Oxygen pressure range 2mbar—3bar max

Accuracy 5mbar max

Internal operational temp 700°C

Response time (10—90% step) < 4s

Warm up time (prior to sensor operation) 60s

Warm up time (from standby) 20s

Output stabilisation time ~ 180s

TECHNICAL SPECIFICATIONS

Heater voltage²

Operating $4.35V_{DC} \pm 0.1V_{DC}$ (1.85A) Standby $2V_{DC}$ (0.85A)

Pump impedance at 700° C³ < $6k\Omega$

Permissible gas temperature -100°C to +250°C

Gas flow rate 0—10 m/s

Repetitive permissible acceleration 5g
Incidental permissible acceleration 30g
Mounting thread M18 x 1.5

Need help? Ask the expert Tel: + 44 (0)1236 459 020 and ask for "Technical"

Other sensor options available on request, email:







- 2) It is important to measure the heater voltage as close to the sensor as possible due to voltage drops in the supply cable.
- 3) The constant current source used in the pump circuit should be designed to drive a load of up to $6k\Omega$.



OUTLINE DRAWING AND MOUNTING INFORMATION


All dimensions shown in mm.

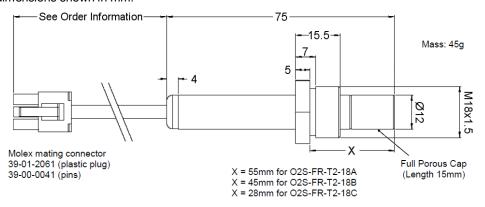

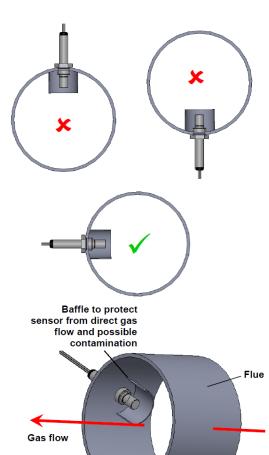




Molex Connector



Pin	Designation
1	Pump (Red)
2	Common (Black)
3	Heater (1) (Yellow)
4	Sense (Blue)
5	Heater (2) (Yellow)

ORDER INFORMATION

Generate your specific part number using the convention shown below. Use only those letters and numbers that correspond to the sensor options you require — omit those you do not.

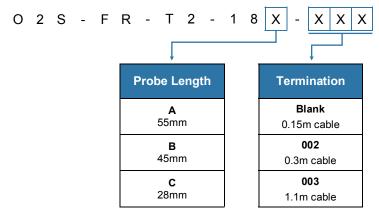



Do not exceed maximum ratings and ensure sensor(s) are operated in accordance with their requirements.

Carefully follow all wiring instructions. Incorrect wiring can cause permanent damage to the device.

Zirconium dioxide sensors are damaged by the presence of silicone. Vapours (organic silicone compounds) from RTV rubbers and sealants are known to poison oxygen sensors and MUST be avoided. Do NOT use chemical cleaning agents.

Failure to comply with these instructions may result in product damage.

INFORMATION

As customer applications are outside of SST Sensing Ltd.'s control, the information provided is given without legal responsibility. Customers should test under their own conditions to ensure that the equipment is suitable for their intended application.

For detailed information on the sensor operation refer to application note AN0043 Operating Principle and Construction of Zirconium Dioxide Oxygen Sensors.

For technical assistance or advice, please email: technical@sstsensing.com

General Note: SST Sensing Ltd. reserves the right to make changes to product specifications without notice or liability. All information is subject to SST Sensing Ltd.'s own data and considered accurate at time of going to print.

