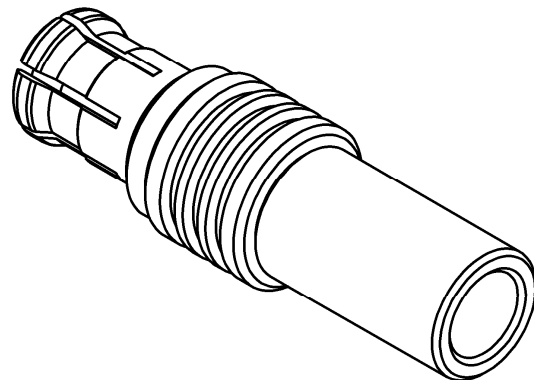
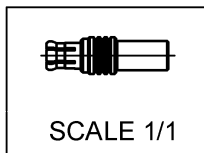
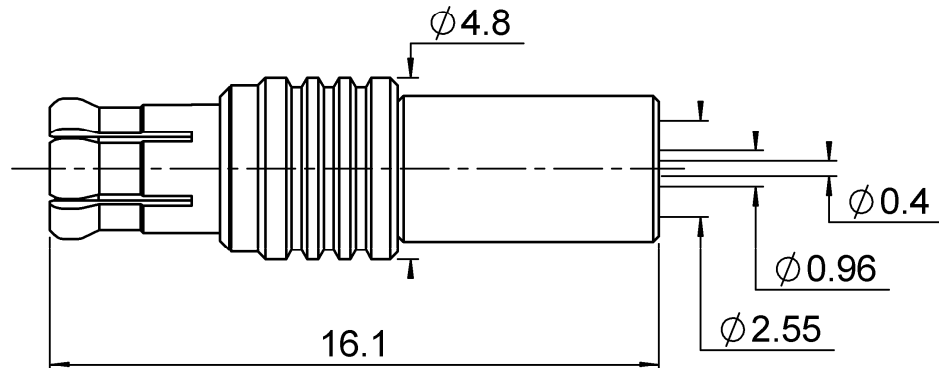



STRAIGHT PLUG CRIMP TYPE**NON MAGNETIC CABLE 2/50 S****R113.081.097**

Series : MCX



All dimensions are in mm.



COMPONENTS	MATERIALS	PLATING (μm)
BODY	NON MAGNETIC BRONZE	BBR
CENTER CONTACT	NON MAGNETIC BRONZE	GOLD OVER COPPER
OUTER CONTACT	BERYLLIUM COPPER	BBR
INSULATOR	PTFE	
GASKET		
OTHERS PARTS	NON MAGNETIC BRONZE	BBR
-	-	-
-	-	-

Issue : 1145 A

In the effort to improve our products, we reserve the right to make changes judged to be necessary.

RADIAL 

STRAIGHT PLUG CRIMP TYPE**NON MAGNETIC CABLE 2/50 S****R113.081.097**

Series : MCX

PACKAGING

Standard	Unit	Other
100	'W' option	Contact us

ELECTRICAL CHARACTERISTICS

Impedance	50	Ω
Frequency	0-6	GHz
VSWR	1.1 + 0,0800	x F(GHz) Maxi
Insertion loss	0.25	$\sqrt{F}(\text{GHz})$ dB Maxi
RF leakage	- (NA	- F(GHz)) dB Maxi
Voltage rating	170	Veff Maxi
Dielectric withstanding voltage	500	Veff mini
Insulation resistance	1000	M Ω mini

MECHANICAL CHARACTERISTICS

Center contact retention	
Axial force – Mating end	NA N mini
Axial force – Opposite end	NA N mini
Torque	NA N.cm mini

Recommended torque	
Mating	NA N.cm
Panel nut	NA N.cm
Clamp nut	NA N.cm
A/F clamp nut	0,0000 mm

Mating life	500 Cycles mini
Weight	0,7490 g

ENVIRONMENTAL

Operating temperature	-55/+125 °C
Hermetic seal	NA Atm.cm3/s
Panel leakage	NA

SPECIFICATION**CABLE ASSEMBLY**

Stripping	a	b	c	d	e	f
mm	2,50	5,50	9,50	0,00	7,00	0,00

Assembly instruction : **Crimp 02**Recommended cable(s)
111258 FTX

Characteristics indicated on this data sheet are those that can be achieved with the highest performance cable. Intrinsic limitations of the cable may diminish the performance of the assembly

Cable retention

- pull off	32 N mini
- torque	NA N.cm

TOOLING

Part Number	Description	Hexagon
.	.	.
R282.235.003	CRIMPING DIES M22520/5-03	3.25
R282.271.000	CRIMPING TOOL	3.25 - SQUARE 0.72
R282.293.000	CRIMPING TOOL M22520/5-01	

OTHER CHARACTERISTICSDistortion of the magnetic field :
<= 0.5 ppm@ 10 mm @ Bo = 1.5 Tesla

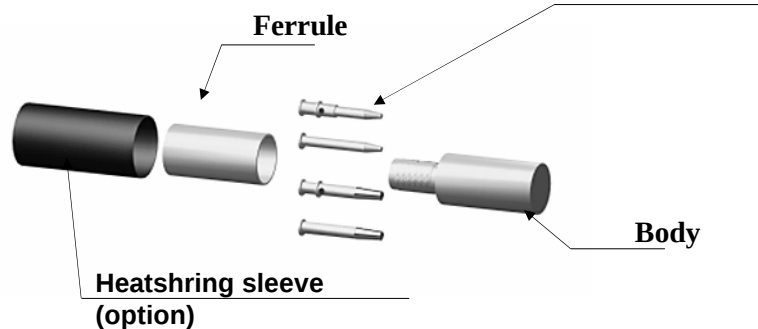
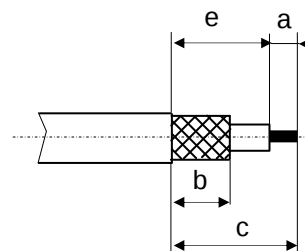
Issue : 1145 A

In the effort to improve our products, we reserve the right to make changes judged to be necessary.

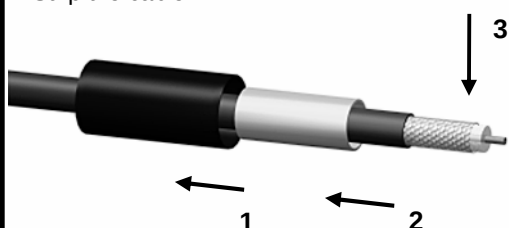
RADIAL 

STRAIGHT PLUG CRIMP TYPE**NON MAGNETIC CABLE 2/50 S****R113.081.097**

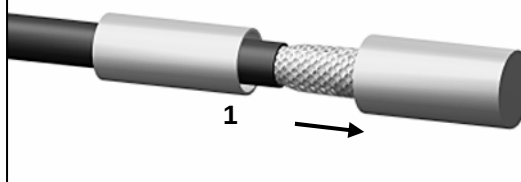
Series : MCX

COMPONENTS**STRIPPING DIMENSIONS****1**

Slide the heatshrink sleeve onto the cable (Option).
Slide the ferrule onto the cable.
Strip the cable.

**4**

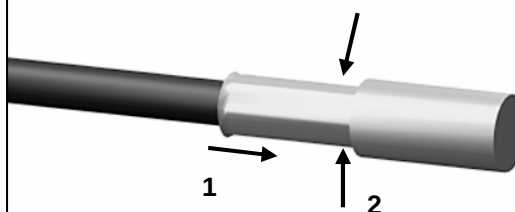
Slide the cable into the body until it bottoms against insulator.

**2**

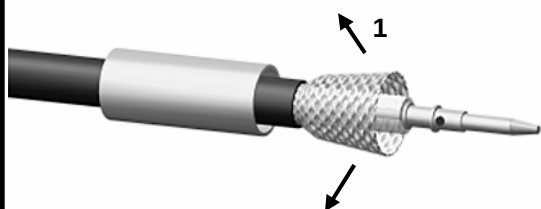
Slide the centre contact on until it bottoms against the cable dielectric.
Crimp the centre contact with crimping tool (see connector TDS).

**5**

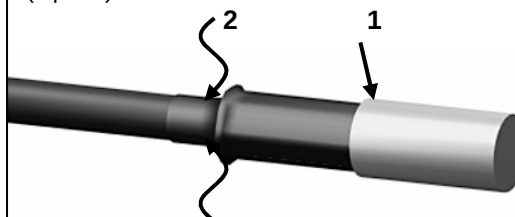
Slide the ferrule over the braid.
Crimp the ferrule with crimping tool (see connector TDS)

**3**

Fan the braid.

**6**

Cut the excess of braid if necessary.
Slide the sleeve over the ferrule and heatshrink it in place (Option).

**Issue : 1145 A**

In the effort to improve our products, we reserve the right to make changes judged to be necessary.

RADIAL