9001K35



Main

| Range of product | Harmony 9001K |
|-------------------------------|----------------------------|
| Product or component type | Joystick controller |
| Device short name | 9001K |
| Sale per indivisible quantity | 1 |
| Type of operator | Spring return |
| Operator profile | 80 mm long operating shaft |

Complementary

| Bezel material | Chromium plated metal |
|-------------------------------|------------------------|
| Mounting diameter | 1.18 in (30 mm) |
| Product weight | 0.82 lb(US) (0.372 kg) |
| Operating position | Any position |
| Shape of signaling unit head | Octagonal |
| Operator position information | 5 positions |
| Contacts type and composition | Without contact block |
| Device presentation | Basic element |

Environment

| protective treatment | TC | | | |
|---------------------------------------|--|----------------------------|--|--|
| ambient air temperature for storage | -40158 °F (-4070 °C) | | | |
| ambient air temperature for operation | -13158 °F (-2570 °C) | | | |
| overvoltage category | II conforming to IEC 61140 | II conforming to IEC 61140 | | |
| IP degree of protection | IP66 conforming to IEC 60529 | | | |
| NEMA degree of protection | NEMA 1 NEMA 12 NEMA 13 NEMA 2 NEMA 3 NEMA 3 NEMA 3R NEMA 4 | | | |
| standards | EN/IEC 60947-1 EN/IEC 60947-5-1 EN/IEC 60947-5-4 JIS C 4520 JIS C 852 UL 508 CSA C22.2 No 14 | | | |
| product certifications | NEMA UL 508 | | | |
| vibration resistance | 7 gn (f = 2500 Hz) conforming to IEC 60068-2-6 | | | |
| shock resistance | 50 gn conforming to IEC 60068-2-27 | | | |

Offer Sustainability

| 785901077145 | 785901077145 |
|---|---|
| Compliant - since 0921 - Schneider Electric declaration of conformity | Compliant - since 0921 - Schneider Electric declaration of conformity |
| Reference not containing SVHC above the threshold | Reference not containing SVHC above the threshold |
| WARNING: This product can expose you to chemicals including: | WARNING: This product can expose you to chemicals including: |

Di-isodecyl phthalate (DIDP), which is known to the StateDi-isodecyl phthalate (DIDP), which is known to the State of California to cause birth of California to cause birth defects or other reproductive defects or other reproductive harm.

For more information go to www.p65warnings.ca.gov


For more information go to www.p65warnings.ca.gov

Contractual warranty

Warranty period

18 months


Contact Block Mounting Position

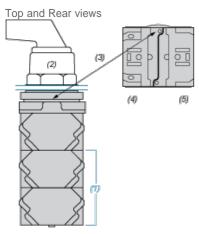

- (1) It is possible to mount up to 3 levels of contacts blocks (maximum of 6 contacts blocks)
- (2) Operator
- (3) Locating notch
- (4) Side 1
- (5) Side 2

Panel Cut-Out


Clearance

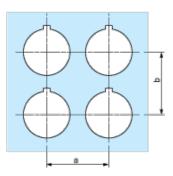

| Legend plate | a min. | | b min. | |
|--------------|--------|------|--------|------|
| | mm | in. | mm | in. |
| 9001KN2•• | 57.2 | 2.25 | 44.5 | 1.75 |
| 9001KN3•• | 57.2 | 2.25 | 50.8 | 2.00 |

Individual Cut-outs Details

2 alternatives

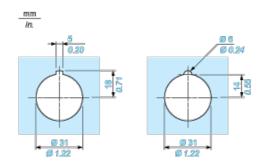

Joystick Positions

